mercruiser STERNDRIVES & INBOARDS

# service bulletin

TO: SERVICE MANAGER ☐ TECHNICIANS ☐
PARTS MANAGER ☐

No. 98-11

# Required MIE 7.4L MPI (L29) ECM Replacement

## Models

1998 MIE 7.4L MPI (L29) Inboard Engines: S/N 0L002006–0L007302

***NOTE:*** *This does not apply to 1998 MCM 7.4L MPI (L29) Sterndrive Engines.*

## Situation

Under certain operating conditions, the engine may stall when shifted into reverse gear.

## Inspection

An ECM with a check sum number of A194 is good and it does not need to be replaced. If the ECM has any other check sum number, it must be replaced.

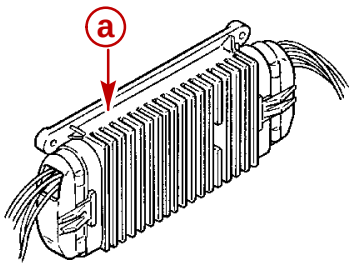


72801

**a -** Check Sum Number On White Tag - A194 Is The Correct ECM.

## Order

861736T 1 ECM (A194)

## Warranty

Fill out warranty claim and send it to your normal warranty processing center. More than one engine can be put on the warranty claim if you list the part number, engine model, serial number, warranty code and labor hours for each engine on separate lines on warranty claim.

Warranty Code and Labor:

| | | |
|---|---|---|
| Replace ECM | MJ23 | 0.8 Hours |

Old Part: USA and Canada: Return with the warranty claim.
All Others: Retain for disposition by a Marine Power representative.


Printed in U.S.A. - © 1998, Mercury Marine
provided by http://www.crowleymarine.com