mercruiser STERN DRIVES & INBOARDS

parts bulletin

QUICKSILVER MARINE PARTS AND ACCESSORIES

TO: PARTS MANAGER ☐
SERVICE MANAGER ☐

No. 95-2

V6 & V8 Replacement Cylinder Heads

Models

MCM V6 262 cid Stern Drive Engines.

MCM V8 305 & 350 cid Stern Drive Engines.


MIE V8 305 & 350 cid Inboard Engines.

Replacement Cylinder Heads


Before ordering a replacement cylinder head for any of these engines, look at the hole in the cylinder head that the push rods come through. Also look at the type of rocker arms that came off. If the rocker arms are not the “Self Aligning” type rocker arms, all new rocker arms must be ordered also. All replacement heads have a hole for the push rod. If “Self Aligning” type of rocker arms are not used with these new heads, the rocker arm will not stay on the push rod.

Rocker Arm Part Number

35329 Rocker Arm & Ball

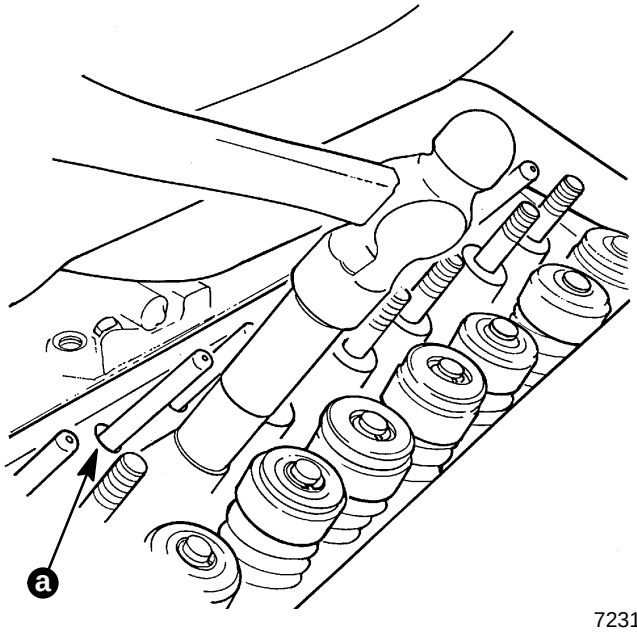

72311

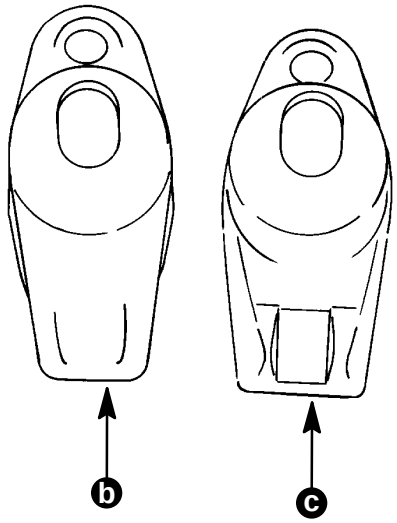

74445

a - Push Rod Hole: Slot=Keeps Push Rod Aligned.
Drilled Hole=Must Use “Self Aligning” Rocker Arm.
b - “Non Self Aligning” Rocker Arm.
c - “Self Aligning” Rocker Arm.

provided by http://www.crowleymarine.com